


Remote I/O R9 Series

MULTI POWER MONITORING UNIT

(Clamp-on current sensor CLSE, LonWorks)

Functions & Features

- Multi Power Monitoring Unit for LonWorks.
- By using clamp-on current sensors, there is no need of current transformers.
- Up to 8 circuits can be measured. (Common voltage measurement)
- Current sensors are easy to install in existing systems. Wide input range of 5 to 600 A is available.
- All measured values, counter values, display mode, setting data are stored in the non-volatile memory when power is off.
- By using SD card, data logging of current and power etc. with calendar is available.

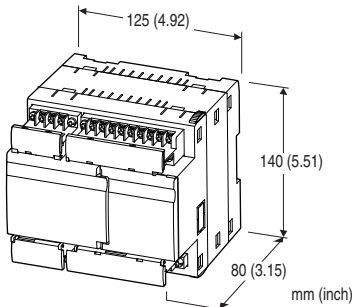

MODEL: R9LWTU-2001-AD4

ORDERING INFORMATION

- Code number: R9LWTU-2001-AD4

CONFIGURATION

2: Single-phase/2-wire, 3-phase/3-wire, single-phase/3-wire; 8 circuits

CONNECTION

0: Terminal block

I/O

0: Without

EXTENSION UNIT

1: With connection

AUXILIARY POWER SUPPLY

AD4: universal

100 - 240 V AC (Operational range 85 - 264 V, 50 / 60 Hz) /

110 - 240 V DC (Operational range 99 - 264 V,

ripple 10 %p-p max)

RELATED PRODUCTS

- Discrete I/O Extension Unit (model; R9WTU-ED)
- Multi power Monitoring Extension Unit (model; R9WTU-EP)
- PC configurator software (model: PMCFG)
- XIF File (Device Interface File)

XIF file is used to define a LonWorks device when programmed on LonMaker.

The XIF files and Software are downloadable at M-System's web site.

To connect the module to a PC a dedicated cable is required (refer to M-System's web site or instruction manual).

- Clamp-on current sensor (model: CLSE)
- The clamp-on current sensors, not included in this product package, must be ordered separately. Required number depends upon the system configuration.
- SD card

A SD card is required to store data in the unit.

Use the specified model number of memory card.

Available for purchase from M-System. Consult M-System.

- Hagiwara Solutions NSD6-004GH (NSDA-004GT, NSDA-004GL ... discontinued)
- Apacer Technology AP-ISD04GIS4B-3T (AP-ISD04GIS4B-T ... discontinued)

GENERAL SPECIFICATIONS

Construction: Stand-alone

Degree of protection: IP20

Connection

Auxiliary power or voltage input: M3.5 screw terminals (torque 0.8 N·m)

Current input: M3 screw terminals (torque 0.5 N·m)

Network: M3 screw terminals (torque 0.5 N·m)

Recommended solderless terminal

• **Applicable wire size**

M3 screw: 0.3 to 0.75 mm²

M3.5 screw: 0.75 to 2 mm²

• Solderless terminals with insulation sleeve is not available.

• Refer to the drawing on the end of this section.

Configuration: Single-phase/2-wire, single-phase/3-wire, 3-phase/3-wire

Screw terminal: Nickel-plated steel

Housing material: Flame-resistant resin (black)

Isolation: Sensor core to sensor output or current input or voltage input to LonWorks to auxiliary power to FE1

■ Measured variables

Voltage: R - N, S - N, T - N, R - S, S - T, T - R

Current: R, S, T, N

Active / reactive / apparent power: R, S, T, Σ

Power factor: R, S, T, Σ

Frequency

Active energy: Incoming

Reactive energy: Incoming lag

Active / reactive / apparent power intervals (demand)

Average (demand) current: R, S, T, N

Harmonic contents: Σ

Voltage: R - N, S - N, T - N, R - S, S - T, T - R

Current: R, S, T, N


Max. and min. values

Calendar log (inserting SD card): Voltage, Current, power, electric energy, power factor


Operating mode setting: Connection, clamp-on sensor selection

Status indicators: Power, SD Card

■ Recommended solderless terminal size - M3 (unit: mm)

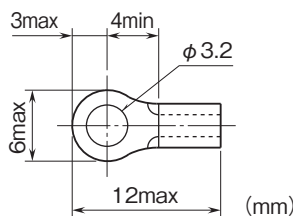

■ Recommended solderless terminal size - M3.5 (unit: mm)

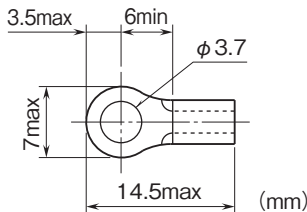

LonWorks COMMUNICATION

Neuron Chip: FT3120 (NeuronID printed in numbers and bar code [peel-off code 39 format])

Transceiver: FT-X1 (equivalent to FTT10A)

Transmission speed: 78 kbps

Twisted-pair cable

Distance, free topology: 500 meters

Max. 64 nodes/channel

LNS: Ver. 3.0 Service Pack 8 or higher

Status indicator: ONLINE, ERR, TX/RX, SVCE (service)

Operation switch: Service, reset

INPUT SPECIFICATIONS

Frequency: 50 / 60 Hz (45 - 65 Hz)

• **Voltage Input**

Rated voltage

• **Between lines:** 400 V AC

• **Line-neutral (phase voltage):** 230 V (single-phase / 2-wire and 3-wire)

Input burden: $\leq U_{LN}^2 / 300 \text{ k}\Omega$ / phase

Overload capacity: 200 % of rating for 10 sec., 120 % continuous

Selectable primary voltage range: 50 - 400 000 V

• **Current Input**

CLSE-R5: 0 - 5 A AC

CLSE-05: 0 - 50 A AC

CLSE-10: 0 - 100 A AC

CLSE-20: 0 - 200 A AC

CLSE-40: 0 - 400 A AC

CLSE-60: 0 - 600 A AC

Overload capacity: 120 % continuous, 500 % for 10 sec.

Selectable primary current range: 1 - 20 000 A (Using CLSE-R5 the unit is configurable only with LonMaker.)

Operational range

Current: 0 - 120 % of the rating

Voltage: 10 - 120 % of the rating

Apparent power: ≤ 120 % of the rating

Active/reactive power: ± 120 % of the rating

Frequency: 45 - 65 Hz

Power factor: ± 1

INSTALLATION

Auxiliary power supply

• **AC:** < 9 VA

• **DC:** < 3 W

Operating temperature: -10 to +55°C (14 to 131°F)

Operating humidity: 30 to 90 %RH (non-condensing)

Atmosphere: No corrosive gas or heavy dust

Mounting: Surface or DIN rail

Weight: 500 g (1.1 lb)

PERFORMANCE

Accuracy (at 10 - 35°C or 50 - 95°F, 45 - 65 Hz)^{*1}

Add the accuracy of the current sensor for overall values.

Voltage: ± 0.5 % of the rating^{*2}

Current: ± 0.5 % of the rating^{*2}

Power: ± 0.5 % of the rating^{*2}

Power factor: ± 1.5 %

Frequency: ± 0.1 % of the rating^{*2}

Energy: ± 1 %

Harmonic contents: ± 2 % of the rating^{*2}

*1. Sensor error margin not included

*2. The described accuracy levels are ensured at the input 1 % or more for phase 2 current with 3-phase/3-wire unbalanced load, for neutral current with 3-phase/4-wire unbalanced load, and neutral current with 1-phase/3-wire.

Data update period:

Harmonic contents and frequency: ≤ 1 sec.

Other: ≤ 500 msec.

Calendar clock: (with battery backup)

Accuracy: Monthly deviation 3 minutes at 25°C

Back up period: Approx. 2 years at 25°C without power

With the power on, no battery drain

Battery: Primary lithium battery (non-removable)


Insulation resistance: ≥ 100 MΩ with 500 V DC

Dielectric strength: 2000 V AC @ 1 minute

(current input or voltage input to LonWorks to auxiliary power or FE1)

EXTERNAL VIEW

FRONT VIEW

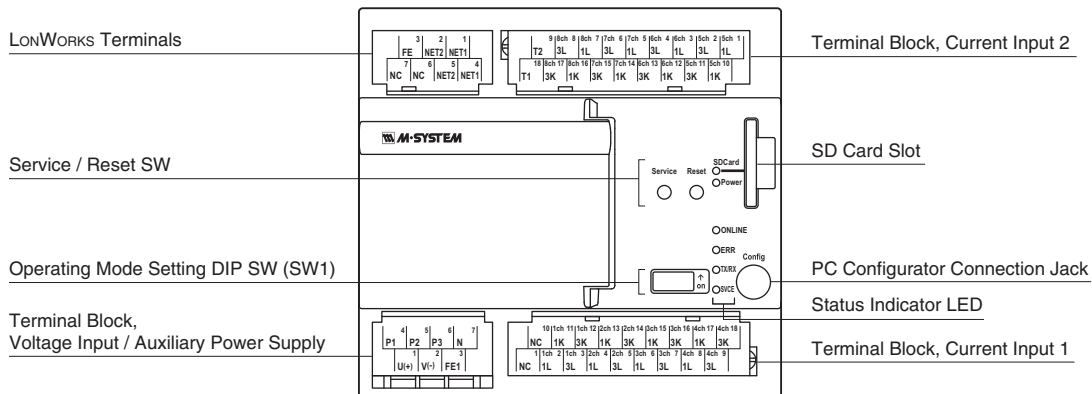

TERMINAL CONNECTIONS

Use the model CLSE clamp sensor for current inputs.


The figure below shows only one circuit. At the maximum of eight (8) current sensor inputs are available (1ch through 8ch).

Grounding is not required for low voltage circuits.

System / Application	Terminal	System / Application	Terminal
Single-phase / 2-wire		Three-phase / 3-wire balanced load	
Single-phase / 3-wire		Three-phase / 3-wire unbalanced load	


CONNECTION DIAGRAMS

■ MASTER CONNECTION

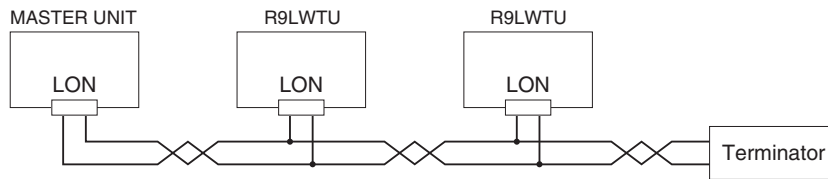


TERMINAL ASSIGNMENTS

• Network




No.	ID	FUNCTION
1	NET1	LONWORKS comm. 1
2	NET2	LONWORKS comm. 2
3	FE	Comm. ground
4	NET1	LONWORKS comm. 1
5	NET2	LONWORKS comm. 2
6	NC	Unused
7	NC	Unused

• Current Input 2




No.	ID	FUNCTION	No.	ID	FUNCTION
1	5ch 1L	Ch.5, Current input 1L	10	5ch 1K	Ch.5, Current input 1K
2	5ch 3L	Ch.5, Current input 3L	11	5ch 3K	Ch.5, Current input 3K
3	6ch 1L	Ch.6, Current input 1L	12	6ch 1K	Ch.6, Current input 1K
4	6ch 3L	Ch.6, Current input 3L	13	6ch 3K	Ch.6, Current input 3K
5	7ch 1L	Ch.7, Current input 1L	14	7ch 1K	Ch.7, Current input 1K
6	7ch 3L	Ch.7, Current input 3L	15	7ch 3K	Ch.7, Current input 3K
7	8ch 1L	Ch.8, Current input 1L	16	8ch 1K	Ch.8, Current input 1K
8	8ch 3L	Ch.8, Current input 3L	17	8ch 3K	Ch.8, Current input 3K
9	T2	Unused	18	T1	Unused

• Auxiliary Power Supply, Voltage Input




No.	ID	FUNCTION
1	U(+)	Auxiliary power (+)
2	V(-)	Auxiliary power (-)
3	FE1	Power ground
4	P1	Voltage input P1
5	P2	Voltage input P2
6	P3	Voltage input P3
7	N	Voltage input N

• Current Input 1




No.	ID	FUNCTION	No.	ID	FUNCTION
1	NC	Unused	10	NC	Unused
2	1ch 1L	Ch.1, Current input 1L	11	1ch 1K	Ch.1, Current input 1K
3	1ch 3L	Ch.1, Current input 3L	12	1ch 3K	Ch.1, Current input 3K
4	2ch 1L	Ch.2, Current input 1L	13	2ch 1K	Ch.2, Current input 1K
5	2ch 3L	Ch.2, Current input 3L	14	2ch 3K	Ch.2, Current input 3K
6	3ch 1L	Ch.3, Current input 1L	15	3ch 1K	Ch.3, Current input 1K
7	3ch 3L	Ch.3, Current input 3L	16	3ch 3K	Ch.3, Current input 3K
8	4ch 1L	Ch.4, Current input 1L	17	4ch 1K	Ch.4, Current input 1K
9	4ch 3L	Ch.4, Current input 3L	18	4ch 3K	Ch.4, Current input 3K

DIMENSIONS unit: mm (inch)

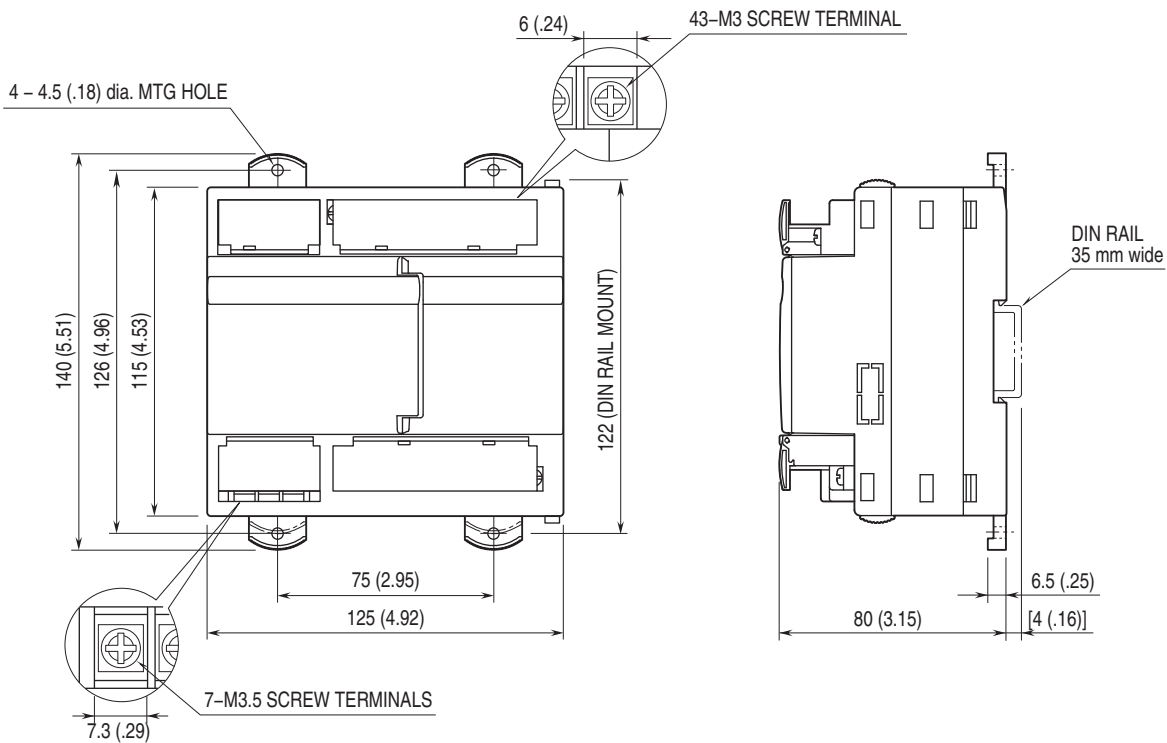


MOUNTING REQUIREMENTS unit: mm (inch)


■ SINGLE MOUNTING

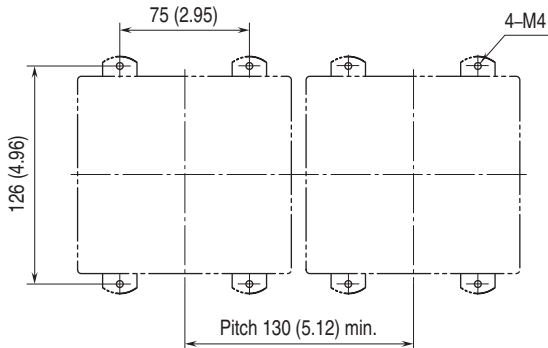

■ BASIC + EXTENSION UNIT

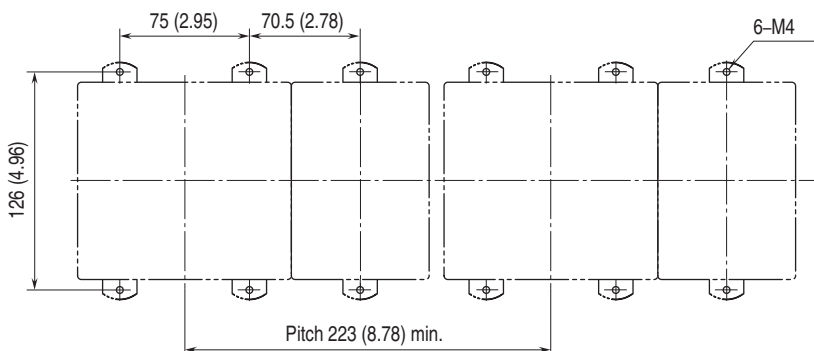

SCHEMATIC CIRCUITRY & CONNECTION DIAGRAM

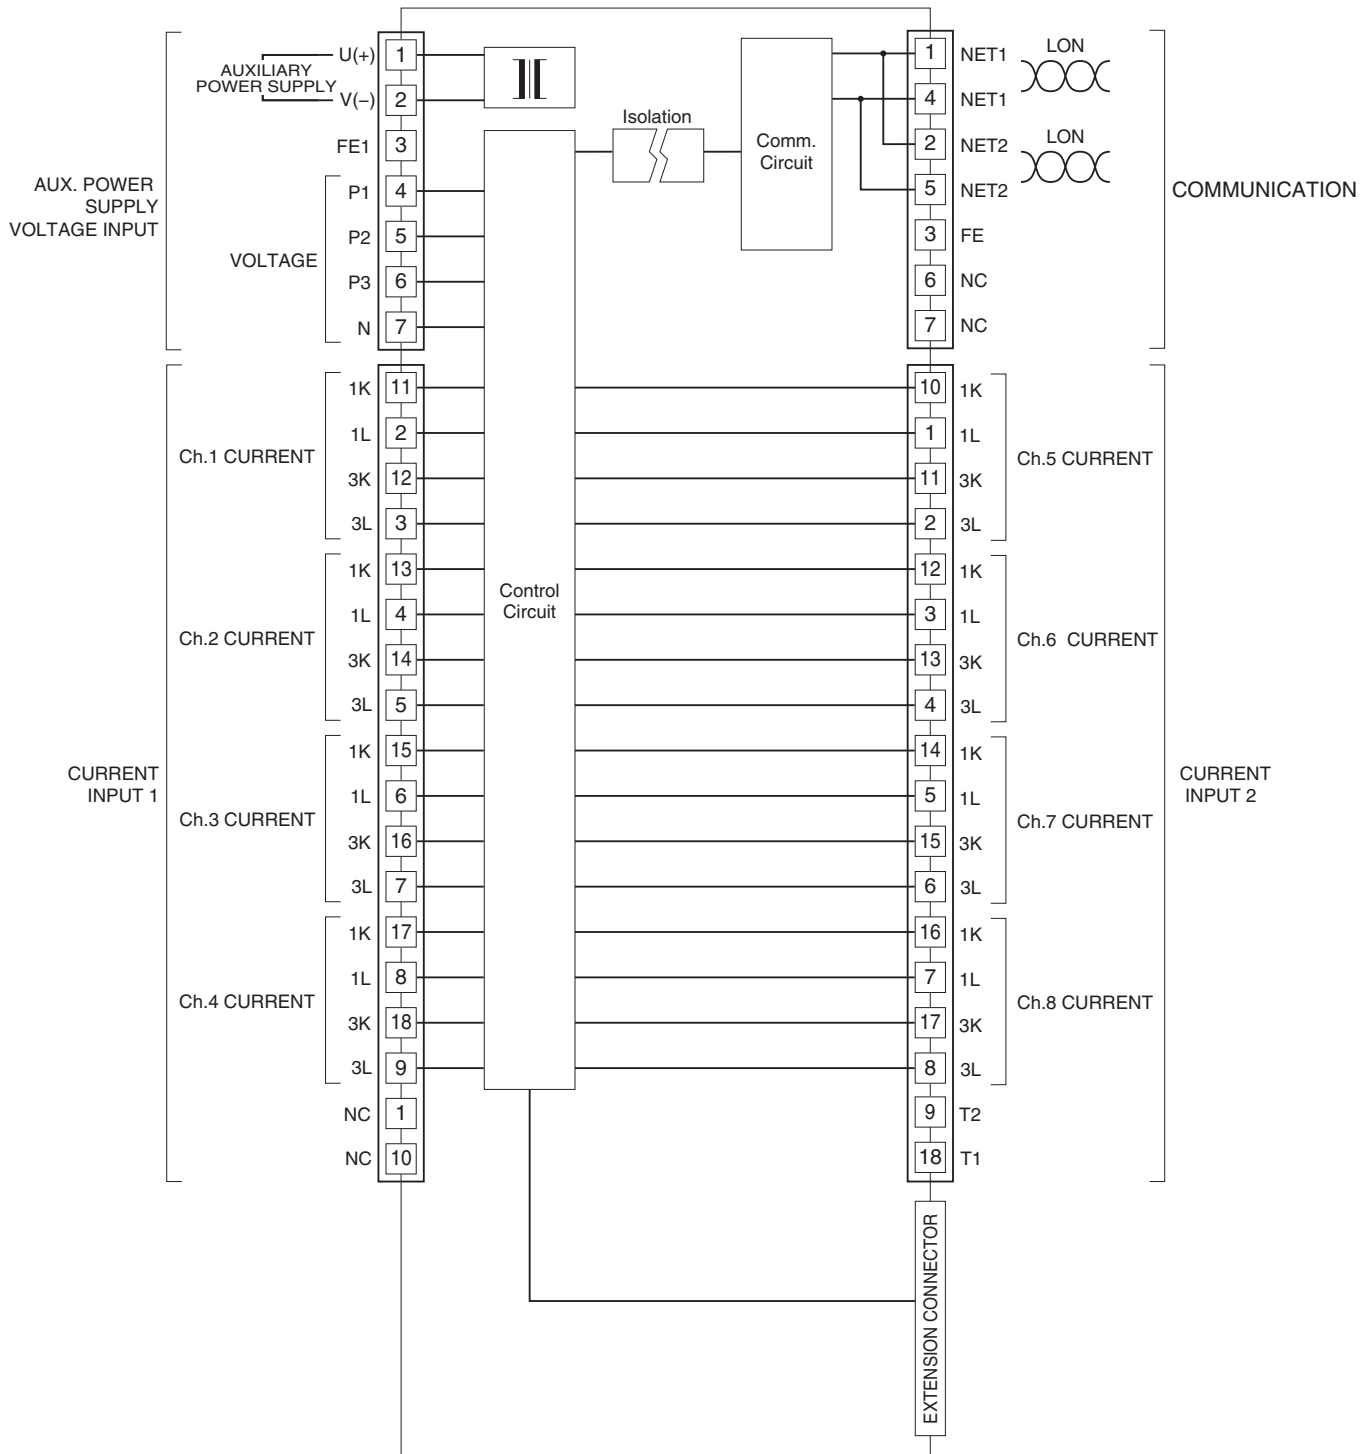

Specifications are subject to change without notice.